[redacted]

CTX 5500 DS Radiation Emissions Survey

1.0 Name and Address of Facility and Specific Location of X-ray System

A.	Name of Facility	GUM
B.	FDA Region	Not Applicable
C.	Street Number/Name, R.R. Number or Airline/Airport	GUM
D.	City	Guam
E.	State	GUAM
F.	Zip Code	96921
G.	Telephone Number	[redacted]
H.	Certification Label Present	Yes
I.	Instruments (Model Type and Serial Number)	Model Type 451P-RYR Serial Number 1805
J.	Meter Calibration Date	(Previous) 17-Nov-10

1.1 Manufacturer and Product ID

A.	Manufacturer (Responsible Firm)	Morpho Detection, Inc.
B.	Manufacturer Code	Not Applicable
C.	System Model Number and/or Name	CTX 5500 DS
D.	Unique ID	Not Applicable
E.	System Serial Number	C608
F.	Date of Manufacture (Month/Year)	Dec-02

1.2 (Not Used)

1.3 Operator Instructions Available Yes

1.4 Maintenance Schedule Available Yes

2.0 Warning Label Indicators

A.	Warning Label Present at Controls Stating "Caution: X-rays Produced when Energized"	Yes
B.	Warning Label Present at Ports Stating "Caution: Do Not Insert Any Part of the Body When System is Energized: X-ray Hazard"	Yes
C.	Two Indicators Labeled "X-ray On" Present at Controls (One May be Labeled "mA Meter")	Yes
D.	At Least One Indicator, Marked "X-ray On" Visible From Each Port, Door and Access Panel	Yes

Note: The two indicators for InVision Technologies' systems for "X-ray On" at the controls are the red lamp on the console and the x-ray indicator on the SP monitor.

[redacted]

[redacted]

3.0 Interlocks

A.	"Captured Key" Control	Yes
B.	Door Safety Interlocks:	
	i. Minimum Number of Interlocks Visible at Any One Door	N/A
	ii. At Least One Interlock Dependent on No Moving Part Except Door	N/A
C.	Prevention of X-radiation by Interlocks	
	i. All Doors and Access Panels That Were Tested Prevent Generation of X-radiation	Yes
	ii. Use of X-ray Control Necessary to Resume Operation Following Interruption	Yes

4.0 Ports and/or Apertures

A.	Some Part of the Body Can Be Inserted Through a Port Into the Primary Beam	No
B.	Some Part of the Body Can Be Inserted Into an Aperture	No

5.0 (Not Used)

6.0 Baggage Inspection System

A.	Means Provided to Ensure Operator Presence at the Control Area	No
B.	Means Provided to Operator for Terminating Exposures of Greater than One-Half Second and Preventing Additional Exposures of Less than One-Half Second	Yes

7.0 Radiation Emissions

A. Scatter Block Description: 100499-1

B. Technical Factors

CT:	180	kV	3	mA
SP:	140	kV	0.852	mA

C. Location and Exposure Levels

i. Reasonable Number of Exposures That May be Initiated in One Hour: N/A

~OR~

ii. Duty Cycle of System Indicated as a Percentage of One Hour: </=100%

[redacted]

[redacted]

8.0 Additional Information

A.

B.

C.

D.

9.0 Surveyor Information

A. Surveyor Name

User Name: [redacted]
User Domain: MORPHODETECTION.COM
Radiation Survey Client Version: 3.03
Radiation Survey Form Revision: B

First [redacted]
Middle [redacted]
Last [redacted]

Survey Type: Full Survey
Clientele Call #: PM44525NWK_HQ

☑ **I certify that the information I am submitting on this form is accurate, complete and reflects the true record of the work I performed.** *Date Certified:* *11-Mar-11 12:07:57 PM*

B. Surveyor Signature (Hard Copy Only)

C. Date of Radiation Emissions Survey: 11-Mar-11

D. Surveying Agency Code: Not Applicable

Employees are advised that an inaccurate certification is a violation of GE's Spirit & Letter policies and may result in disciplinary action up to and including termination.

10.0 Remarks

Date Certified: *11-Mar-11 12:07:57 PM*

Status: ✓ Approved | **Date:** 3/10/2011 | **Administrator:** [redacted]

Administrator Comments:

[redacted]

[redacted]

Audit Results:

No Compliance Issues Found.

[redacted]

[redacted]

CTX 5500 DS SP ENTRANCE VIEW

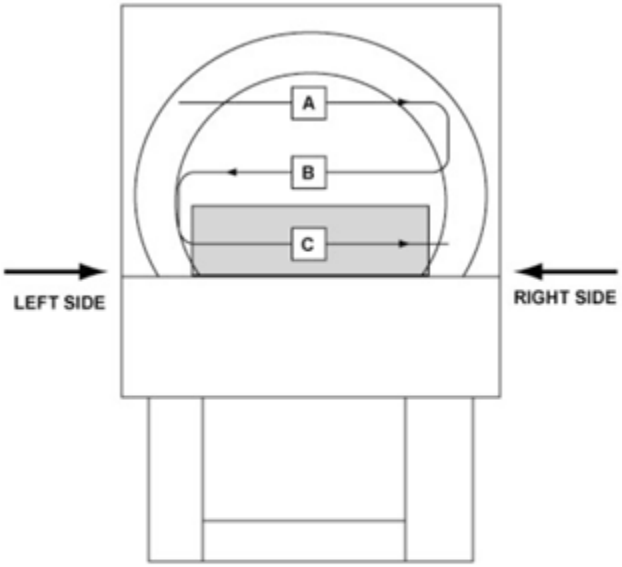

All measurements are in MicroRads per hour.
All measurements should be made at the surface of the enclosure.

100

Circle the area and enter the dose value if the reading is greater than 100 MicroRads per hours.

In these areas, perform a cursory dose measurement.

In these areas, perform a thorough dose measurement.

Record the radiation levels as indicated on the table below.

Area #	A	B	C
Radiation value in uR/Hr	38	48	69

[redacted]

[redacted]

CTX 5500 DS SP LEFT SIDE

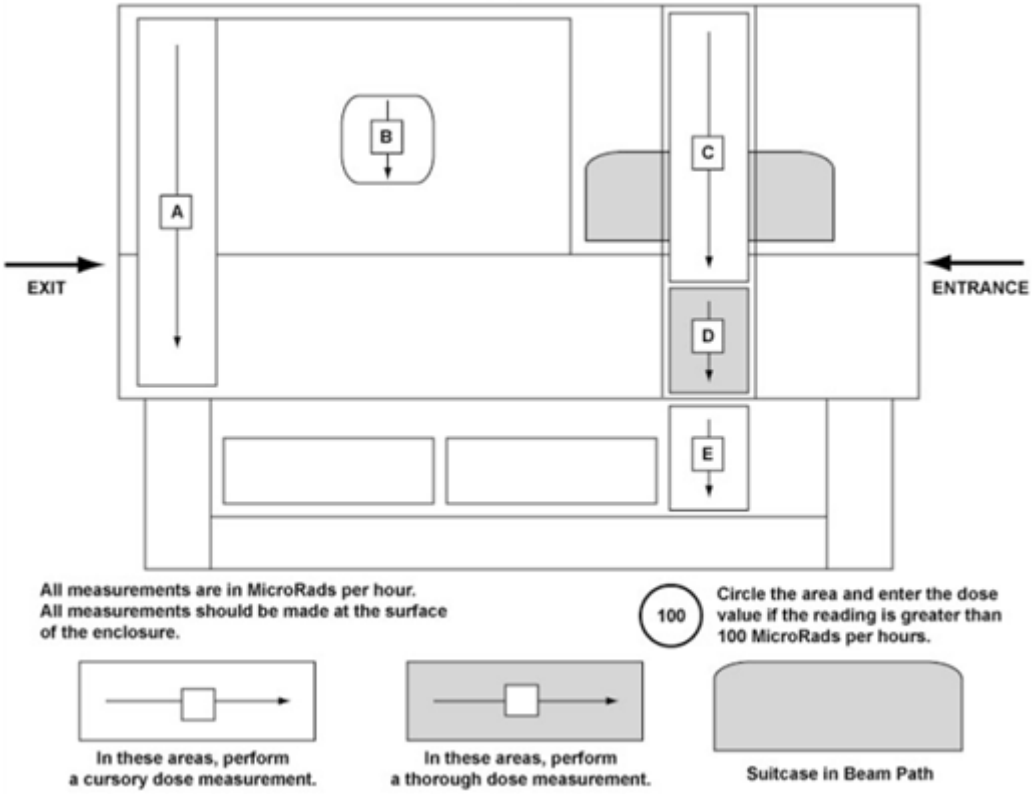

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E
Radiation value in uR/Hr	5	5	12	19	7

[redacted]

[redacted]

CTX 5500 DS SP RIGHT SIDE

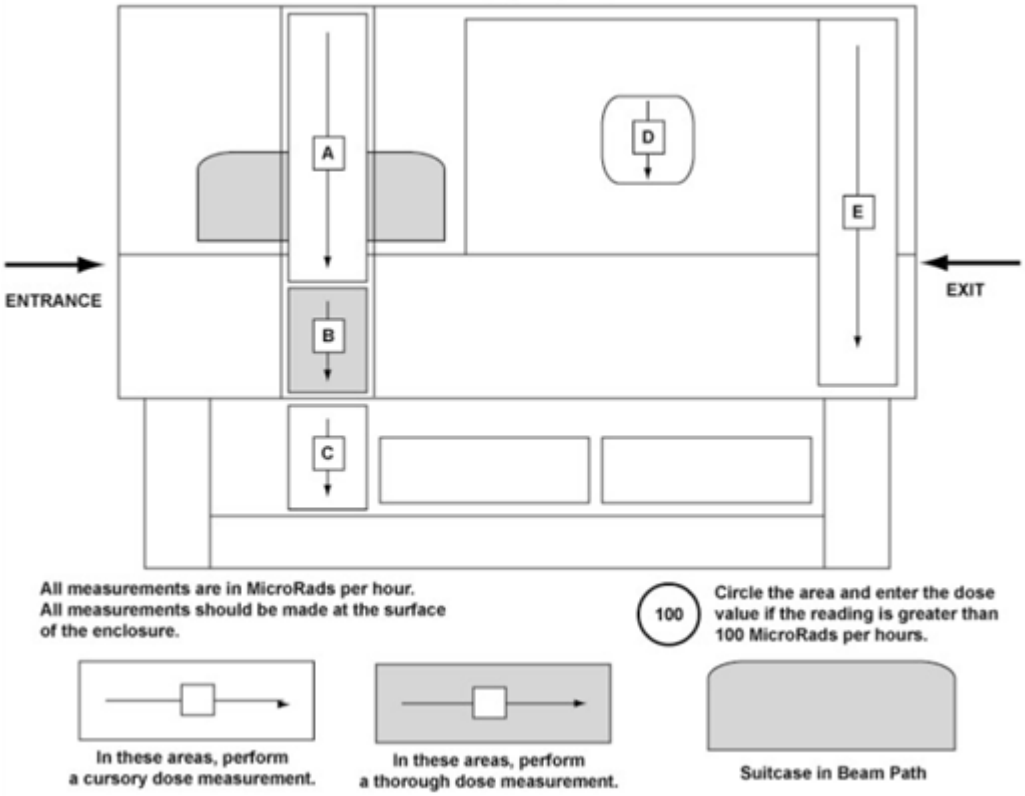

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E
Radiation value in uR/Hr	6	12	7	12	6

[redacted]

[redacted]

CTX 5500 DS SP TOP SIDE

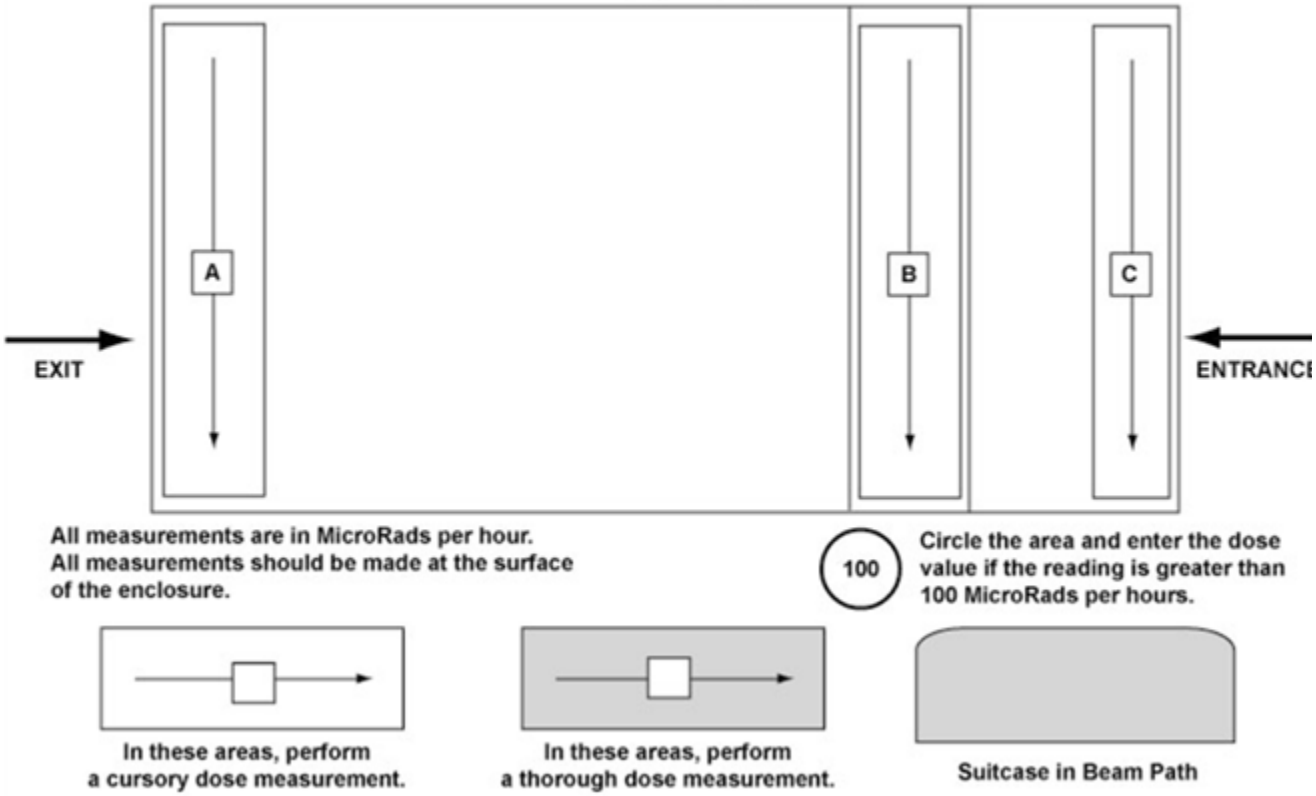

Record the radiation levels as indicated on the table below.

Area #	A	B	C
Radiation value in uR/Hr	5	8	7

[redacted]

[redacted]

CTX 5500 DS ENTRANCE VIEW

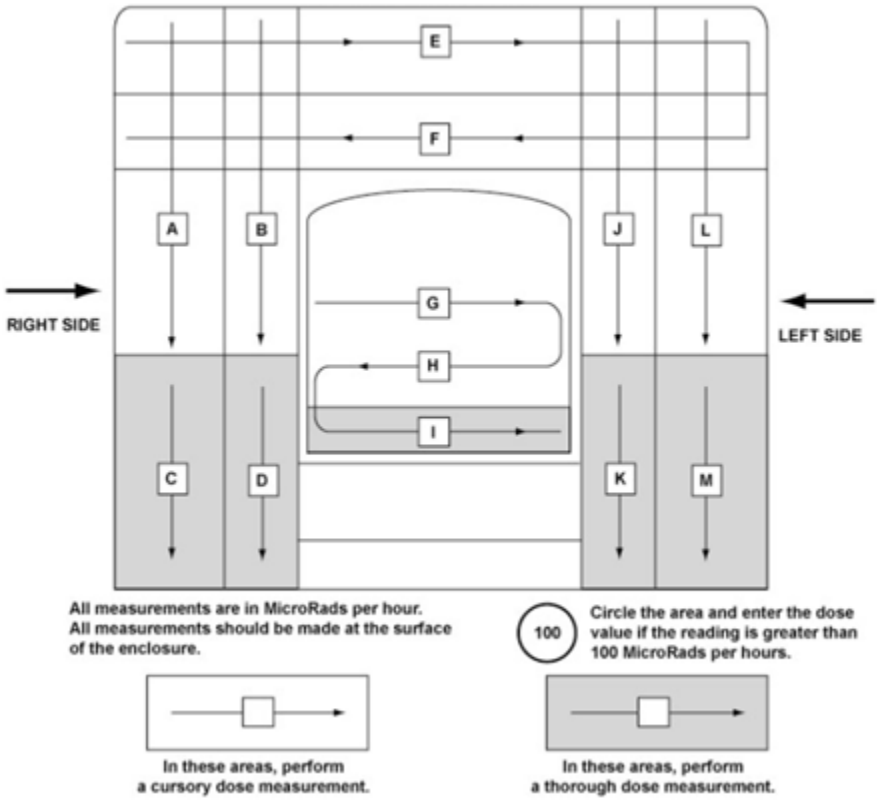

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E	F	G	H	I	J	K	L	M
Radiation value in uR/Hr	16	17	7	23	8	15	N/A	N/A	N/A	7	7	14	22

[redacted]

[redacted]

CTX 5500 DS LEFT SIDE

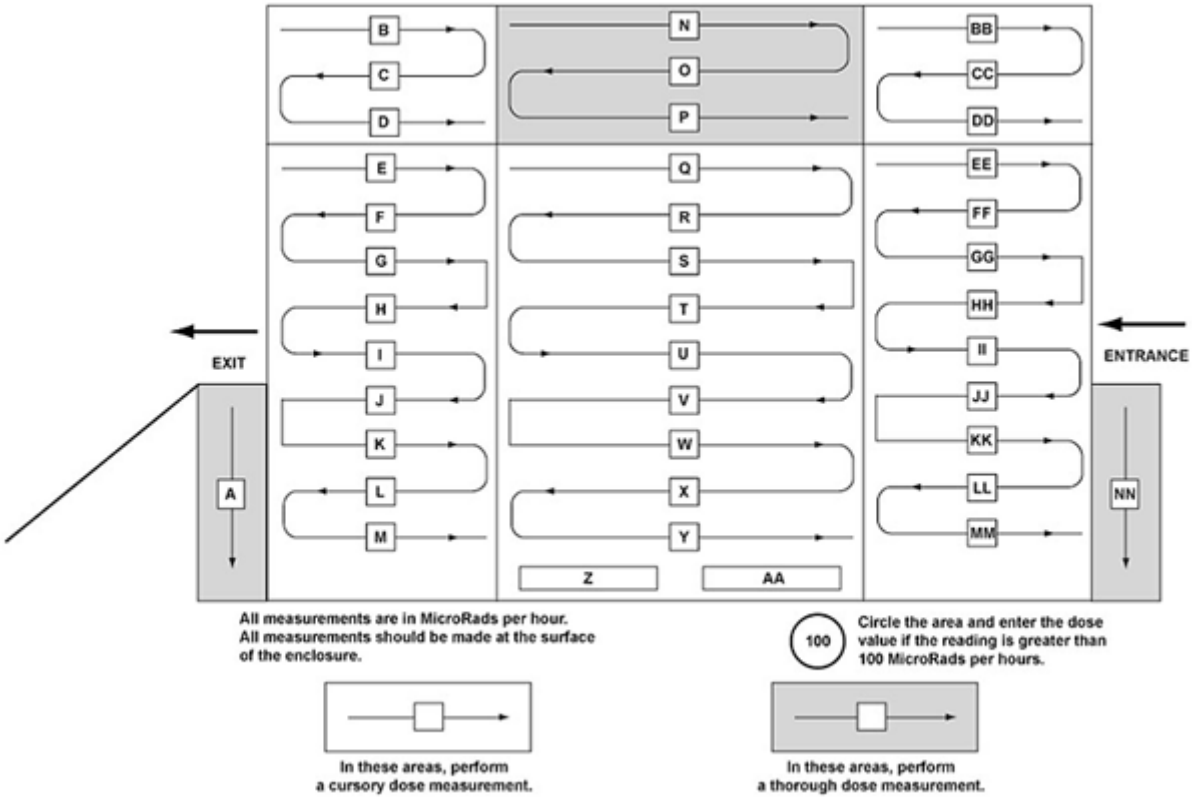

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T
Radiation value in uR/Hr	8	8	9	8	10	5	5	4	5	5	6	5	7	30	51	34	32	7	9	12
Area #	U	V	W	X	Y	Z	AA	BB	CC	DD	EE	FF	GG	HH	II	JJ	KK	LL	MM	NN
Radiation value in uR/Hr	7	8	9	7	10	16	14	9	9	6	8	7	5	6	5	9	10	12	10	12

[redacted]

[redacted]

CTX 5500 DS EXIT VIEW

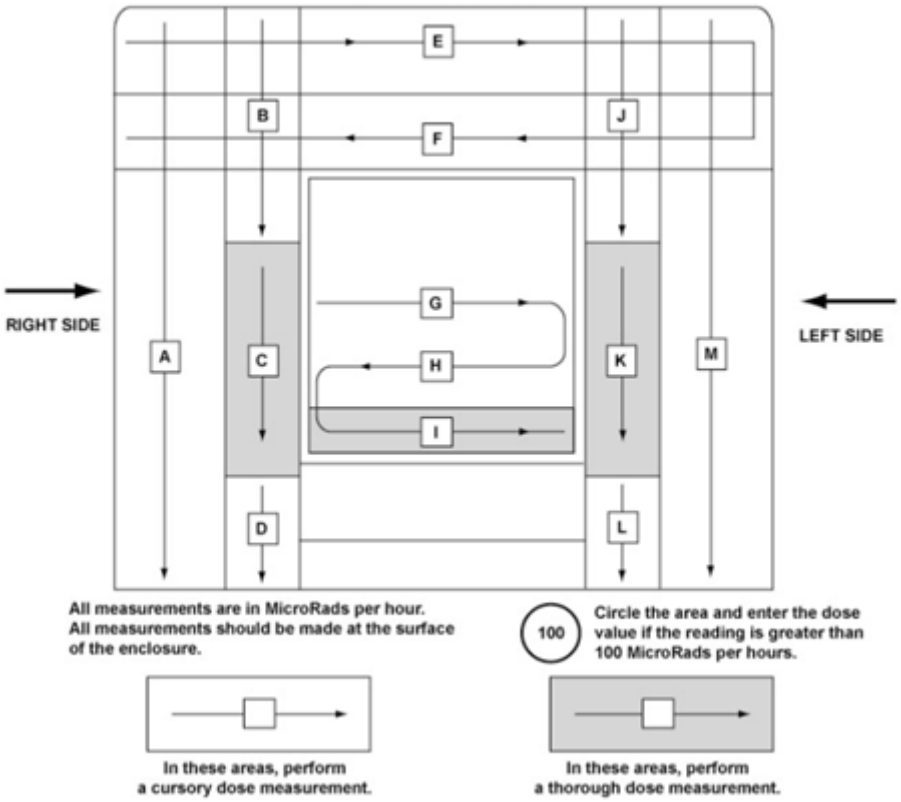

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E	F	G	H	I	J	K	L	M
Radiation value in uR/Hr	11	6	32	20	6	6	9	10	10	6	12	7	11

[redacted]

[redacted]

CTX 5500 DS RIGHT SIDE

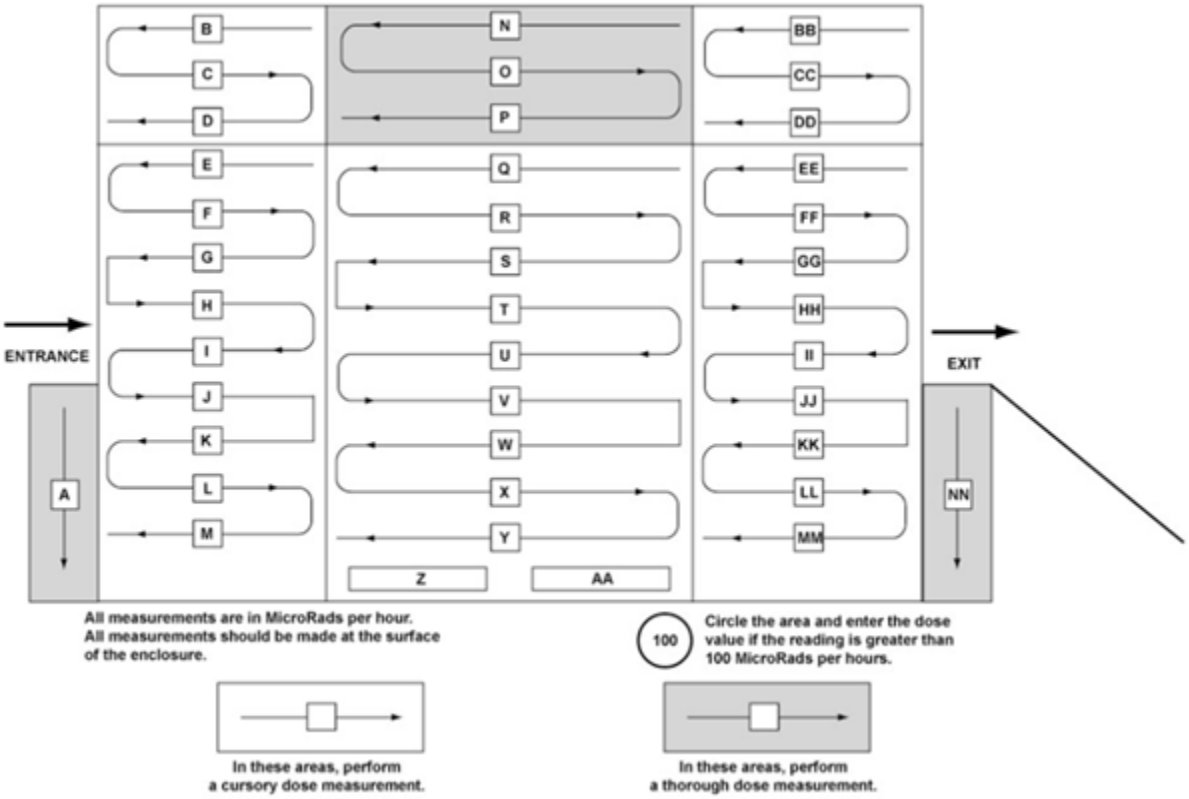

Record the radiation levels as indicated on the table below.

Area #	A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T
Radiation value in uR/Hr	9	10	13	11	11	9	5	10	5	8	5	12	5	36	44	40	30	12	7	9
Area #	U	V	W	X	Y	Z	AA	BB	CC	DD	EE	FF	GG	HH	II	JJ	KK	LL	MM	NN
Radiation value in uR/Hr	6	6	10	9	10	14	15	4	9	10	5	5	5	7	8	6	10	8	10	24

[redacted]

[redacted]

CTX 5500 DS TOP SIDE

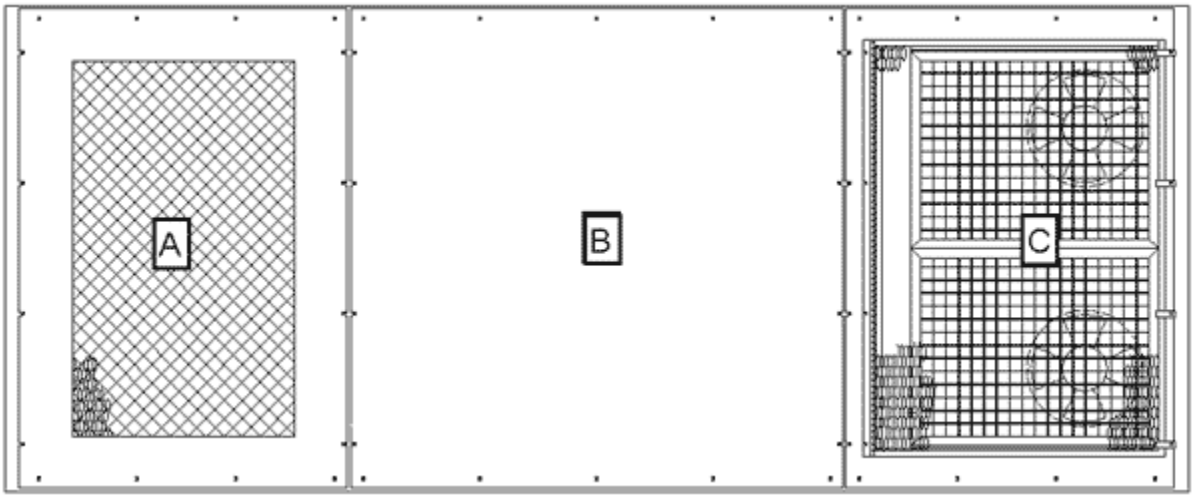

Record the radiation levels as indicated on the table below.

Area #	A	B	C
Radiation value in uR/Hr	13	43	12

[redacted]

©Copyright 2003-2011, Morpho Detection, Inc. All Rights Reserved.